

Work Order ID 147119

Thursday, June 02, 2016 8:18:57 AM

147119

Page 1

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Stop ***NS2***Start Date: 6/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/16/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: MLJ Date: **JUN 02 2016** Tooling: _____ Date: _____Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D2580-041	G

100 Document Control 0.00

100

DC Memo 0.00

Doc.Control -USB or Paperwork Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG005

SMB

16/7/14

110 BENDING MACHINE - SKIDTUBES 0.02

110

CNC Bend 1 Memo 0.07

CNC Delta 100 Bender

1-Bend as per program D2580.C on CNC Bender and Folio 16

2-Cut tubes as per Dwg. D2580

3- scribe batch# in aft end of tube

16-6-29/14

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	Pressure/Forced ☐		Temperature/Cure ☐		Power Loss/Surge ☐	
Design ☐	☐ Operator	Bending ☐		Set-up ☐		Folio/Program ☐	
Doc/Data ☐	☐ Offset/Setup	Centre Not Concentric ☐		BOM/Route ☐		Grain ☐	
Equip/Tooling ☐	☐ Supplier	Cracks ☐		Broken/Damage/Defect ☐		Weld ☐	
Handling/Pre ☐	☐ Training	Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐		Wrong Stock Pulled ☐	
Material ☐	☐ Use for Testing	Cuffs ☐		Contamination ☐		Out of Sequence ☐	
Internal Transport ☐	☐ Poor Information	Crushing ☐		Countersink ☐		Off-set ☐	
Tribal Knowledge ☐	☐ Rushing	Heat Treat ☐		Cut Too Short ☐		Mislabeled ☐	
LOA ☐	☐ Product Improvement	Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐		Fit/Function ☐	
Substation ☐	☐ Process Improvement	Marks/Chatter ☐		Drill Holes ☐		Misaligned/off center ☐	
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____					
Misidentified ☐	☐ Past Due						

Thursday, June 02, 2016 8:18:57 AM

147119

Page 2

Accept

N900040100

Setup Start *NS1*

Stop *NS2*

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 6/16/2016 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/
Work Center ID

Operation Description

Set Up/ Run Hours

Tool ID**Tool #****Plan
Code**

**Accept
Qty**

Reject
QtyReject
Number**Insp.
Stamp**

120

0.00

120

0.21

Skidtubes

Memo

1- Deburr ends and remove bending marks

2- Prepare tube for welding as per QSI 004

130

QC5- Inspect part completeness to step on W/O

0.00

130

0.00

QC

Memo

Quality Control

DAS
18
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause			FAULT CATEGORY						
Environment ☐	☐	No Re-verification	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design ☐	☐	Operator	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data ☐	☐	Offset/Setup	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling ☐	☐	Supplier	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre ☐	☐	Training	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material ☐	☐	Use for Testing	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport ☐	☐	Poor Information	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge ☐	☐	Rushing	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA ☐	☐	Product Improvement	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation ☐	☐	Process Improvement	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date ☐	☐	Manufacturing Process	OTHER : _____						
Misidentified ☐	☐	Past Due							

Work Order ID 147119

Thursday, June 02, 2016 8:18:57 AM

147119

Page 3

Item ID: D205-634-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH
Start Date: 6/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/16/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140		0.00							
140									
Skidtubes									
Skidtubes									
	Memo	0.26							
	1-Weld step D2576 as per Dwg. D2580 and QSI 004 A/R Aluminum Rod <i>MB4826</i>								<i>8E 16-07-04</i>
	2-Grind welds on step as per Dwg D2580								
	3- Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002 and dwg. Hold x-bolt with DT9701 Use tube expander 1/2 x17G to start expansion and finish with 1/2 x 18G to achieve dwg dimention.								<i>16-7-4-M.G</i>
	4-Drill holes for wearplates using DT 8217 & DT8937, 7.40" from most fwd saddle holes (ref only) Open holes to 19/64", adjust stopper not to hit web.Deburr								<i>16-7-4-M.G</i>
	6-Drill pilot holes for aft cap using DT 8215Open holes to 0.208". Deburr								<i>16-7-4-M.G</i>
	7-Drill pilot holes for Tow ring using DT8091, open to .640"and Deburr								
150	QC10- Inspect visual per QSI004- ground welds	0.00							
150									
QC									
Quality Control	Memo	0.00							<i>16-07-05</i>

DAS
9
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Work Order ID 147119

Thursday, June 02, 2016 8:18:57 AM

147119

Page 4

Item ID: D205-634-041 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH
 Start Date: 6/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 6/16/2016 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC5- Inspect part completeness to step on W/O	0.00							DAS 9 9-89
160									
QC	Memo	0.00							D 1607-05
Quality Control									
170	Pressure Wash per QSI005 4.3	0.00							DAS 34 9-89
170									
HandFinish	Memo	0.09							2016/07/05
Hand Finishing	Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch and leave fwd cap out of solution.								BEB
180	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
180									
Powdercoat	Memo	0.05							1 16-07-06 DAS 34 9-89
Powder Coating	START TIME: 8:05. OVEN TEMPERATURE: 320° FINISH TIME: 8:35.								

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause				FAULT CATEGORY					
Environment ☐	☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐			
Design ☐	☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐			
Doc/Data ☐	☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐			
Equip/Tooling ☐	☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐			
Handling/Pre ☐	☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐			
Material ☐	☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐			
Internal Transport ☐	☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐			
Tribal Knowledge ☐	☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐			
LOA ☐	☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐			
Substation ☐	☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐			
Past Expiry Date ☐	☐	Manufacturing Process ☐	OTHER : _____						
Misidentified ☐	☐	Past Due ☐							

Work Order ID 147119

Thursday, June 02, 2016 8:18:57 AM

147119

Page 5

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/16/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

190

QC3- Inspect Part Finish

0.00

190

QC

Memo

0.00

Quality Control

1.0 0.0 16/07/06

DAS
15
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
OTHER : ☐									

Work Order ID 147119

Thursday, June 02, 2016 8:18:57 AM

147119

Page 6

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/16/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200		0.00							
200 HandFinish	Memo	0.26							
Hand Finishing	1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates A/R Sikaflex-291 <u>M134743</u> Sikaflex expire date: <u>16/11</u>								
	2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580 <u>RTU 548 M134053 16/6 9</u>								
	3-Inspect for foreign object per QSI 024								
	4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive A/R Sikaflex-291 <u>M134743</u> Sikaflex expire date: <u>16/11</u>								
	5-Wing Walk as per Dwg D2580 and QSI 005 4.4 Batch: <u>M134448</u>								

11 6 16/07/07

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause			FAULT CATEGORY							
Environment ☐	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design ☐	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data ☐	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling ☐	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre ☐	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material ☐	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport ☐	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge ☐	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA ☐	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation ☐	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date ☐	☐	Manufacturing Process	OTHER : _____							
Misidentified ☐	☐	Past Due								

Work Order ID 147119

Thursday, June 02, 2016 8:18:57 AM

147119

Page 7

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/16/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	QC5- Inspect part completeness to step on W/O	0.00				1			DAS 38 9-89
210									
QC	Memo	0.00							
Quality Control	Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024								JUL 11 2016
220		0.00				1			DAS 27 9-89
220	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPPD205-634-041 Location: _____ PPP Rev: _____								JUL 14 2016
230	QC21- Final Inspection - Work Order Release	0.00							DAS 21 9-89
230									
QC	Memo	0.02							
Quality Control									JUL 14 2016 2m 16/07/14.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval			
Description Work Order Deviation				Disposition				Completed By			
Root Cause				FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER : _____											

Picklist Print

Thursday, June 02, 2016 8:19:01 AM

Page 1

Work Order ID: 147119

147119

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/16/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30
KJ IPP Rev P 10.02.19
per PAR09-043 EC verified by:DD
IPP Rev. O 06.02.28 Added paperwork EC
IPP Rev:P 07-07-09 SS Wearplates & Gaskets JLM IPP Rev:Q
10.12.01 as per chg003 DD verf:EC IPP REV:R 12.01.23 AS
PER ECN11-684 VERF:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D4202-1		Manufactured	No			140	Each	614.0000	20	20			
D4202-1									**			16-7-4 M.G	
Spacer													

Location	Loc Qty	Loc Code
LG001	614	
141708	168	
145902	446	

D2580-1		Manufactured	No			110	Each	4.0000	1	1			
---------	--	--------------	----	--	--	-----	------	--------	---	---	--	--	--

D2580-1									**			16-6-29 JH	
205 Bent Tube													

Location	Loc Qty	Loc Code
LG002	4	
145011	4	

D2576-3		Manufactured	No			140	Each	46.0000	1	1			
---------	--	--------------	----	--	--	-----	------	---------	---	---	--	--	--

D2576-3									**			8/16-07-04	
Step (Machining Detail)													

Location	Loc Qty	Loc Code
LG001	46	
136730	1	
142485	5	
144673	40	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : ☐			

Picklist Print

Thursday, June 02, 2016 8:19:01 AM

Page 2

Work Order ID: 147119

147119

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/16/2016

Start Qty: 1.00

Required Qty: 1.00

D2855

Manufactured No

200 Each

35.0000 1 1

D2855

Cap

**

all 16/07/16

Location

Loc Qty

Loc Code

FP001

35

134027

7

137568

28

AN3-5A

Purchased No

200 Each

224.0000 2 2

AN3-5A

Bolt

**

all 16/07/16

Location

Loc Qty

Loc Code

FP001

6

m133686

2

m134055

4

ST350

218

m134502

218

NAS1149D0332J

Purchased No

200 Each

1,434.000 2 2

NAS1149D0332.J

Washer

**

all 16/07/16

Location

Loc Qty

Loc Code

CA

6

m129682

6

FP001

24

m134502

24

ST260a

1200

m134738

600

m134848

600

ST264

204

m134502

204

X2

Thursday, June 02, 2016 8:19:01 AM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Picklist Print

Thursday, June 02, 2016 8:19:01 AM

Page 3

Work Order ID: 147119

147119

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/16/2016

Start Qty: 1.00

Required Qty: 1.00

ALS7-1032-130

AELS8-1032-130 Purchased

No

200

Each

1,310.000

50

50

ALS7-1032-130

**ALS4-1032-130 (M134502*

*(x50) ***

ll

16/07/06

Rivnut

Location

Loc Qty

Loc Code

FG

50

M128649

50

FP001

29

M128649

29

st549

1231

M128649

1231

AN3C4A

Purchased

No

200

Each

1,100.000

50

50

AN3C4A

Bolt

ll 16/07/06

Location

Loc Qty

Loc Code

FG

20

122814

20

FP001

777

M133440

7

M134396

41

M134509

6

M134606

29

M134676

94

M134762

600

OVER002

200

M134861

200

ST350

103

M134134

18

M134396

85

M135127

x50

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause				FAULT CATEGORY					
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Thursday, June 02, 2016 8:19:01 AM

Page 4

Work Order ID: 147119

147119

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/16/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

200

Each

3,757.000

50

50

NAS1149C0332R

WASHER

del 16/07/06

Location

Loc Qty

Loc Code

FP001

1578

M 134962

x50

m132930

1004

m134073

128

m134574

446

GA

141

m133284

141

ST266

2038

m134654

38

m134736

2000

D3566-13

Manufactured

No

200

Each

22.0000

1

1

D3566-13

Gasket Fwd

del 16/07/06

Location

Loc Qty

Loc Code

FG

2

98908

2

FP001

20

144947

20

X1

D3566-5

Manufactured

No

200

Each

21.0000

1

1

D3566-5

Gasket Center Aft

del 16/07/06

Location

Loc Qty

Loc Code

FG

2

139236

2

FP001

19

144273

19

X1

Thursday, June 02, 2016 8:19:02 AM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Thursday, June 02, 2016 8:19:02 AM

Page 5

Work Order ID: 147119

147119

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/16/2016

Start Qty: 1.00

Required Qty: 1.00

D3566-1

Manufactured No

200

Each

41.0000

2

2

D3566-1

Gasket Aft / Fwd

Handwritten: 16/07/06

Location

Loc Qty

Loc Code

FG

8

B147930

Handwritten: 12

117012

4

139221

4

FP001

33

139221

4

140819

1

142848

1

145822

27

D3564-11

Manufactured No

200

Each

13.0000

1

1

D3564-11

Wearplate Aft

Handwritten: 16/07/06

Location

Loc Qty

Loc Code

FG

4

77056

4

FP002

9

B146558

Handwritten: 12

145652

9

D3564-13

Manufactured No

200

Each

17.0000

1

1

D3564-13

Wearpad Fwd

Handwritten: 16/07/06

Location

Loc Qty

Loc Code

FG

2

89044

2

FP001

15

144946

15

Handwritten: 12

Thursday, June 02, 2016 8:19:02 AM

Shop Packet Print

Page 5

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QS1042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER :							

Picklist Print

Thursday, June 02, 2016 8:19:02 AM

Page 6

Work Order ID: 147119

147119

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/16/2016

Start Qty: 1.00

Required Qty: 1.00

D3564-9

Manufactured No

200

Each

10.0000

1

1

D3564-9

Wearplate Fwd

ll 16/02/06

Location

Loc Qty

Loc Code

FG

6

8145843

76950

4

✓

88407

2

FP002

4

145030

4

D3564-5

Manufactured No

200

Each

16.0000

1

1

D3564-5

Wearplate Center

ll 16/03/06

Location

Loc Qty

Loc Code

FG

3

34806

1

89048

2

FP002

13

144896

13

X1

D2594-3

Manufactured No

200

Each

332.0000

16

16

D2594-3

O-Ring

ll 16/02/06

Location

Loc Qty

Loc Code

FP001

332

134838

4

135859

24

138060

2

140770

2

141703

300

✓16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause				FAULT CATEGORY							
Environment	☐		No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design	☐		Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data	☐		Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling	☐		Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre	☐		Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material	☐		Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport	☐		Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge	☐		Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA	☐		Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation	☐		Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date	☐		Manufacturing Process	☐	OTHER :						
Misidentified	☐		Past Due	☐							

Picklist Print

Thursday, June 02, 2016 8:19:02 AM

Page 7

Work Order ID: 147119

147119

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 6/2/2016

Required Date: 6/16/2016

Start Qty: 1.00

Required Qty: 1.00

D2594-1

Manufactured No

200

Each

250.0000

16

16

D2594-1

all 16/07/07

Plug

Location

Loc Qty

Loc Code

FP001

250

119830

68

B147501

 X15

134804

16

145971

134

B147974

 X1

42807

25

88922

7

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

LIST OF MATERIALS					
ITEM	QTY -041	QTY -045	QTY -047	QTY -049	PART NUMBER
1	X				D2580-041
2		X			D2580-045
3			X		D2580-047
4				X	D2580-049
20	1	1	1	1	D2500-1-190
21			16	16	D2570
22	1	1	1	1	D2576-3
23		4			D2579
24	16	16	8	8	D2594-1
25	16	16	8	8	D2594-3
26	1	1	1	1	D2596
27	1	1	1	1	D2855
28	1	1			D3564-5
29	1	1			D3564-9
30	1	1			D3564-11
31	1	1			D3564-13
32	2	2			D3566-1
33	1	1			D3566-5
34	1	1			D3566-13
35	20	20	24	24	D4202-1
36			1		D4406-041
37			1		D4406-043
37				1	D5061-1
37				1	D5061-3
50	50	50			ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130
51	50	50			AN3C4A
52	2	2	2	2	AN3-5A
53			8	8	AN4-45A
54	50	50			NAS1149C0332R
55	2	2	2	2	NAS1149D0332J
56			8	8	MS21042-4

GENERAL NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY (-041/-047/-049) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3 POWDER COAT ASSEMBLY (-045) GREEN SANDEX (REF 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 34.5 lbs
D2580-045 = 34.5 lbs
D2580-047 = 45.1 lbs
D2580-049 = 32.0 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL 20.287 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/-291.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047/-049)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

RELEASED
2014-04-29

STOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
FOR AMENDMENT
WORK ORDER
147119 MJS
16-06-02

G	ADDED -049, -047 WEIGHT UPDATED PER DSI 9598	AJS	14.04.09
F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.06.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	DS	D2580	SHEET 1 OF 9
APPROVED	DS	TITLE	SCALE
DE APPR.	DS	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							



RELEASED
2014-04-29

D5-2
SECTION B-B
SCALE 5X

Diagram illustrating the grinding and flushing locations for the D2576-3 step. The diagram shows a cross-section of the component with the following labels:

- GRIND FLUSH 4 PL
- GRIND FLUSH
- D2576-3 STEP
- GRIND FLUSH
- LOCATION RIDGE ON UNDERSIDE OF D2576-3
- $\nabla \frac{1}{4}$

**AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:**

- 1. INSERT D4202-1 SPACER (20 PLACES)**
- 2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002**
- 3. TRIM / GRIND FLUSH PER QSI 002**

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>AP</i>	DRAWING NO.	REV. C
MFG. APPR.	<i>AP</i>	D2580	SHEET 2 OF 6
APPROVED	<i>AP</i>	TITLE	SCALE
DE APPR.	<i>AP</i>	205 SKIDTUBE ASSEMBLY	NT
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMINGLED IN ANY OTHER MANNER WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : _____							

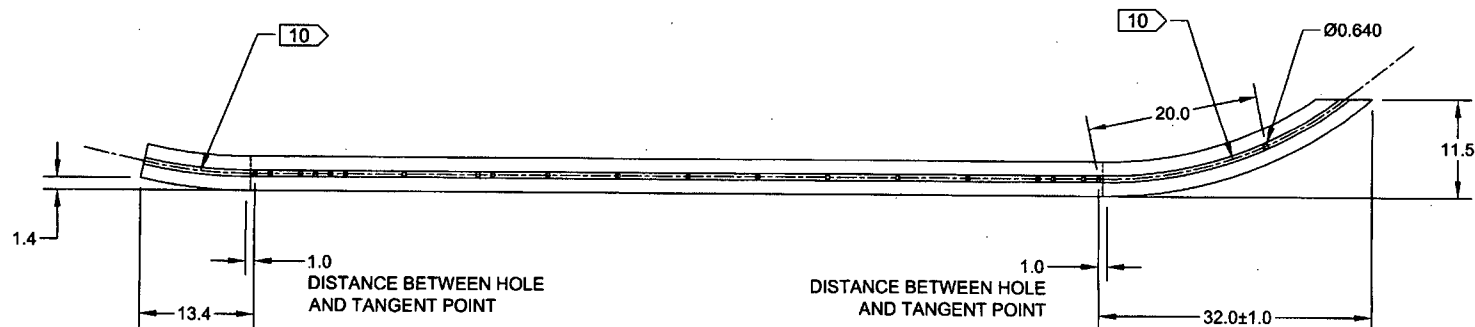

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 3 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :	MRB (QS1042) Approval		
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

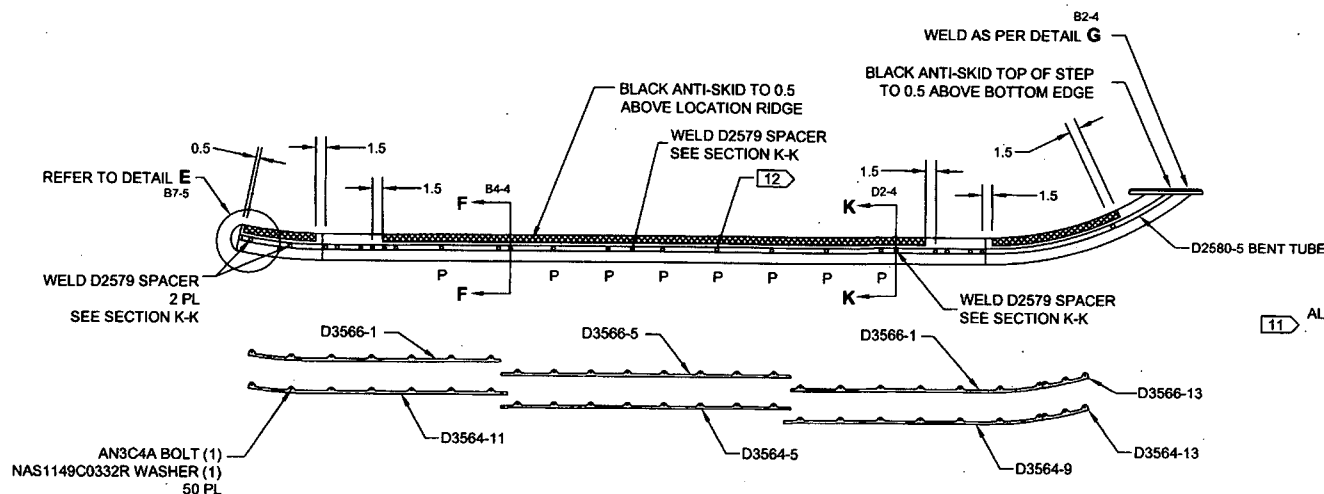


D2580-045 ASSEMBLY DETAIL

SECTION K-K D5-4
SCALE 5X

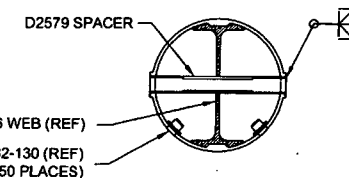


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (4 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. DO NOT C'BORE

DETAIL E D7-4
SCALE 5X

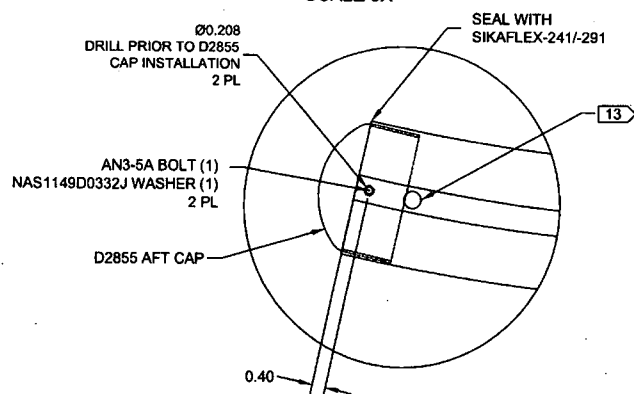


SECTION F-F D5-4
SCALE 5X

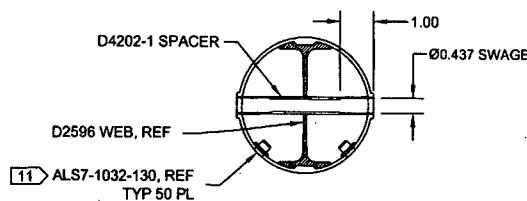

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

DETAIL G D3-4
SCALE 5X

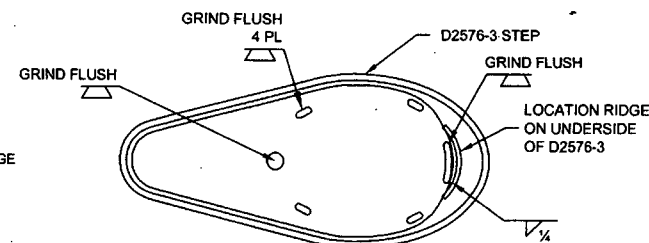

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.R.	DRAWING NO.	REV. G
MFG. APPR.		D2580	SHEET 4 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

RELEASED
2014-04-29

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coor. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

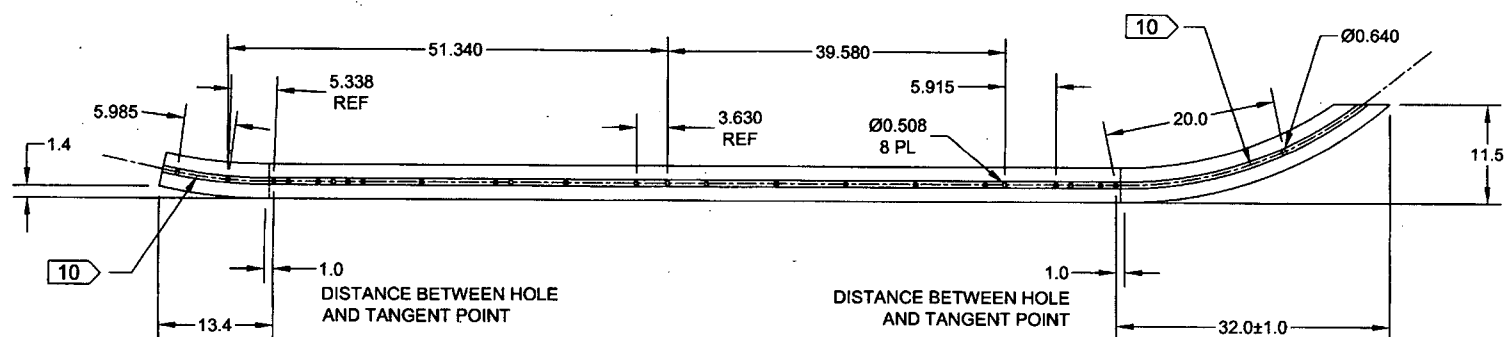

D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.L.	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 5 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____



Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

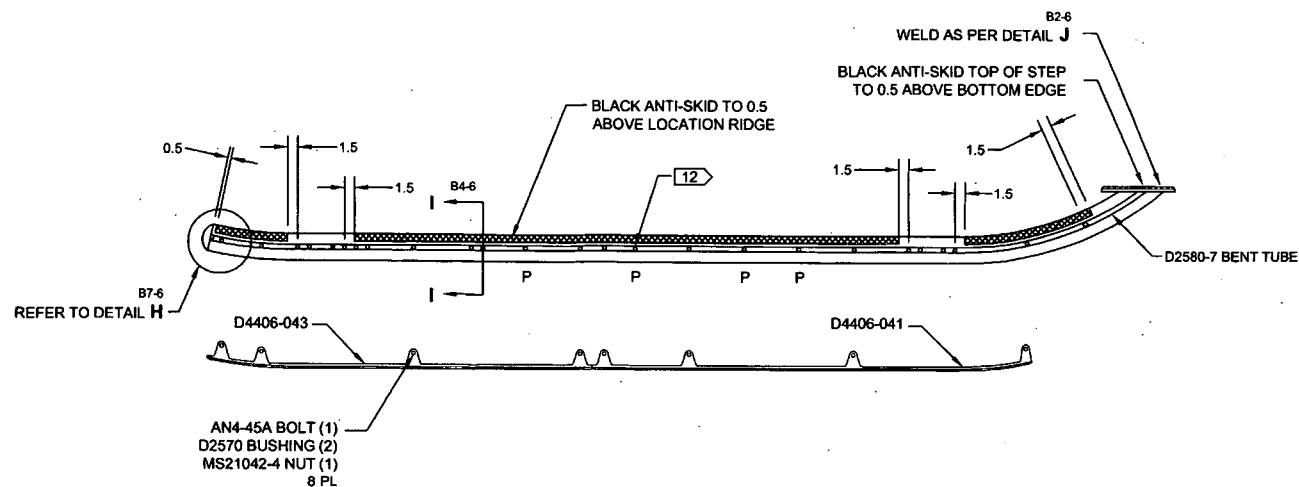


D2580-047 ASSEMBLY DETAIL

RELEASED
2014-04-29

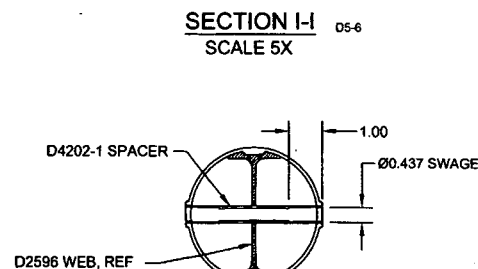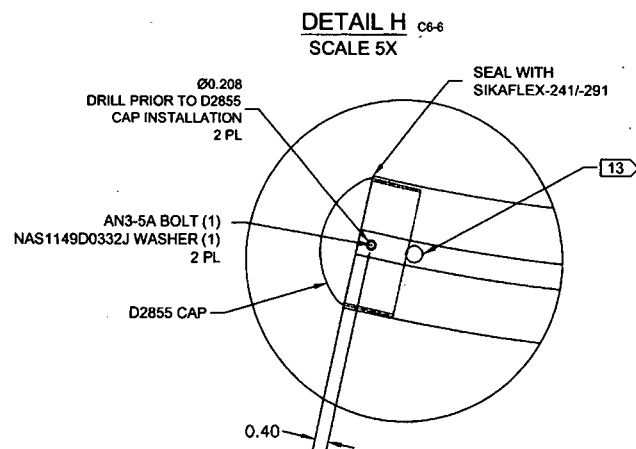

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

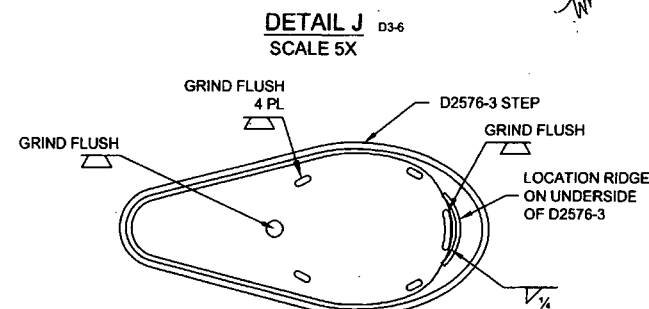

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	M	D2580	SHEET 6 OF 9
APPROVED	M	TITLE	SCALE
DE APPR.	M	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____							
Misidentified ☐	☐ Past Due								

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																											
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval																																																								
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	No Re-verification ☐	Operator ☐	Offset/Setup ☐	Supplier ☐	Training ☐	Use for Testing ☐	Poor Information ☐	Rushing ☐	Product Improvement ☐	Process Improvement ☐	Manufacturing Process ☐	Past Due ☐	Pressure/Forced ☐	Bending ☐	Centre Not Concentric ☐	Cracks ☐	Crimp/Kink/Ripple/Wave ☐	Cuffs ☐	Crushing ☐	Heat Treat ☐	Wave/Twist in Tube ☐	Marks/Chatter ☐	Temperature/Cure ☐	Set-up ☐	BOM/Route ☐	Broken/Damage/Defect ☐	Inspection Incomplete/Unqualified ☐	Contamination ☐	Countersink ☐	Cut Too Short ☐	Instructions Incomplete/Unclear ☐	Drill Holes ☐	Power Loss/Surge ☐	Folio/Program ☐	Grain ☐	Weld ☐	Wrong Stock Pulled ☐	Out of Sequence ☐	Off-set ☐	Mislabeled ☐	Fit/Function ☐	Misaligned/off center ☐	Positioned Wrong ☐	Outside Dimensions ☐	Over/Under tolerance ☐	Part Incorrect ☐	Part Lost/Missing ☐	Part Moved ☐	Drawing ☐	Finish ☐	Misread ☐	Turning Sequence ☐
																								OTHER : ☐																																							

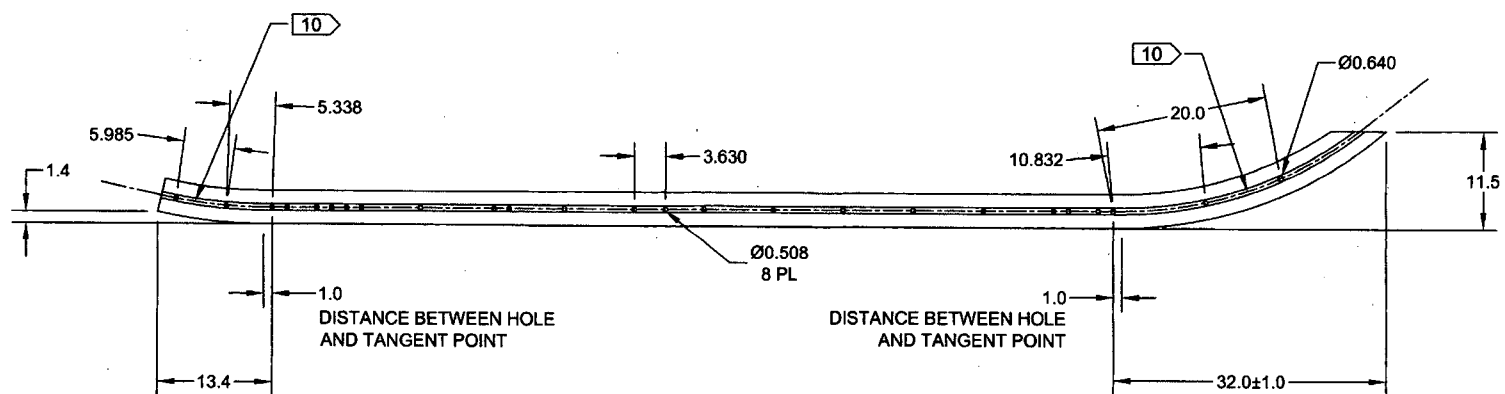

D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29
ND

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	[Signature]	D2580	SHEET 8 OF 9
APPROVED	[Signature]	TITLE	SCALE
DE APPR.	[Signature]	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval 		
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
OTHER :									

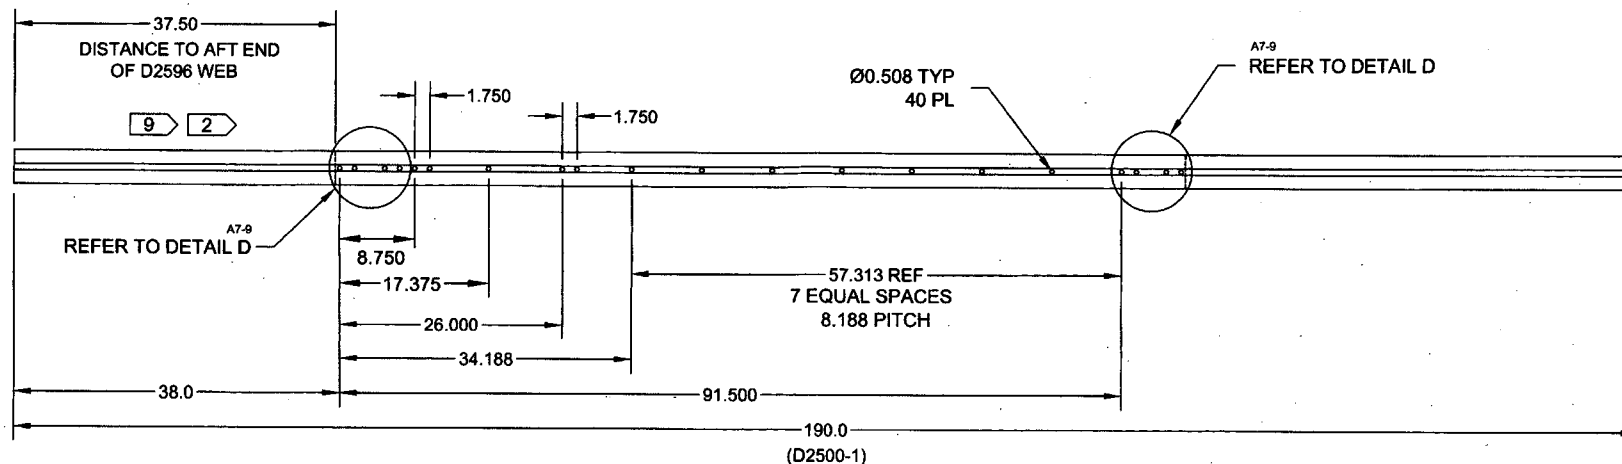

D2580-101 TUBE

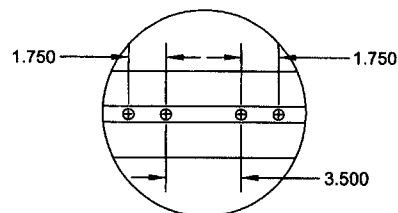

DETAIL D
SCALE 5X

C3-9
C7-9

RELEASED
2014-04-29
WFO

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.		D2580	SHEET 9 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
				Completed By					
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : _____							